

# USB CABLE DATALOGGER



## Optional




**CAL. SALT BOTTLE**  
 P/N:VZ0033AZ1(33%)  
 P/N:VZ0075AZ1(75%)  
 For 8808, 8809  
 Calibration use

## Ordering Code

VZ8808AZ, 8808 logger  
 VZ8809AZ, 8809 logger  
 VZ109BAZ, 9V universal adaptor  
 VZ0033AZ1, 33% salt bottle  
 VZ0075AZ1, 75% salt bottle

## Large LCD/LED Display Temp.+RH% Datalogger 8808/8809

- Button and PC programing are both feasible
- Display Dew point temperature in a click
- 8809 red LED display provides long viewing distance
- Recording function must be powered by adaptor
- Monitoring mode powered by batteries or adaptor  
 -8808:battery or DC adaptor  
 -8809:DC adaptor
- LED flash& buzzer audible warning threshold are programmable
- Salt bottle self-calibration function is integrated

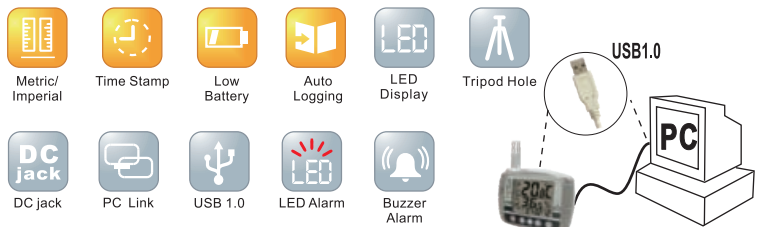

Model	8808	8809
Air temp. range	-20~70°C	
Air temp. resolution	0.1°C/°F	
Air temp. accuracy	+/-0.6°C (0~50°C), others +/-1.2°C	
Humidity. range	0%RH~100%RH	
Humidity resolution	0.1%RH	
Humidity accuracy	+/-3%RH (at 25°C, 10~90%RH, others +/-5%RH)	
Sampling points	8K:T, 8K:RH%	8K:T, 8K:RH%
Button to on/off	YES	YES
USB Interface	YES	YES
LCD size (mm)	51(H)x63(W)	
Display Type	LCD	Red LED
Start logging method	schedule /immediately start/key start/repeat start	
Storage temp.	-20~50°C	
Storage RH%	Humidity < 90%	
Dimension(mm)	120x93x42	
Weight	~200g	~210g
Battery	AA bat.x4pcs or 9VDC adaptor	9VDC adaptor
Standard Package	Meter/Batteries(8808)or adaptor (8809) /Manual /Paper box/software CD/USB cable	
Optional Accessory	RH calibration salt kit	

