



LCD display & buttons

1. LCD display:
- A: measuring reading
- B: measuring unit
- C: laser on icon
- D: back light on icon
- E: battery power icon
- F: scanning icon
- G: data hold icon
- H: mode/emissivity indicator
- I: data storage / read icon
- J: low temperature alarm icon
- K: high temperature alarm icon


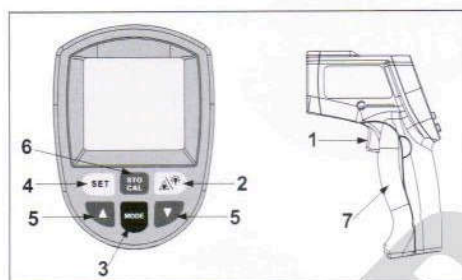


Diagram description

1. Trigger
2. Laser point and a backlight lamp switch
- 3-6. Key functions
7. Celsius / Fahrenheit switch

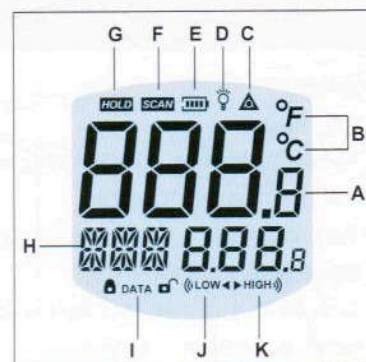

Specification

Temperature range	-50°C~750°C (-58°F~1382°F)
Accuracy	0°C~750°C (32°F~1382°F) : ±1.5°C (±2.7°F) or ±1.5%
	-50°C~0°C (-58°F~32°F) : ±3°C (±5°F) Whichever is greater
Resolution	0.1°C or 0.1°F
Repeatability	1% of reading or 1°C
Response time	500 mSec, 95% response
Spectral response	8um~14 um
Emissivity	0.10~1.00 Adjustable (0.95 Preset)
Distance to Spot size	12:1
Operating Temperature	0°C ~40°C (32°F ~ 104°F)
Operating Humidity	10%RH~95%RH non-condensing, up to 30°C(86°F)
Storage Temperature	-20°C ~ 60°C (-4°F~140°F)
Power	9V Alkaline or NiCd battery
Typical battery life (Alkaline)	Non-laser mode: 22 hrs; Laser Models: 12 hrs
Weight	222g
Dimension	111*50*172mm

Emissivity

Material	Emissivity	Material	Emissivity
Aluminum	0.30	Iron	0.70
Asbestos	0.95	Lead	0.50
Asphalt	0.95	Limestone	0.98
Basalt	0.70	Oil	0.94
Brass	0.50	Paint	0.93
Brick	0.90	Paper	0.95
Carbon	0.85	Plastic	0.95
Ceramic	0.95	Rubber	0.95
Concrete	0.95	Sand	0.90
Copper	0.95	Skin	0.98
Dirt	0.94	Snow	0.90
Frozen food	0.90	Steel	0.80
Hot food	0.93	Textiles	0.94
Glass(plate)	0.85	Water	0.93
Ice	0.98	Wood	0.94