

SPECIFICATIONS

| | |
|------------------|---|
| Range | 0.00 to 5.00 ppm |
| Resolution | 0.01 ppm |
| Accuracy | ±0.04 ppm ±2% of reading @ 25 °C |
| Typical EMC Dev. | ±0.01 ppm |
| Light Source | Light Emitting Diode @ 525 nm |
| Light Detector | Silicon Photocell |
| Method | Adaptation of the EPA Phenantroline method 315B, for natural and treated waters. The reaction between iron and reagent causes an orange tint in the sample. |
| Environment | 0 to 50°C (32 to 122 °F) max. 95% RH non-condensing |
| Battery Type | 1 x 1.5V AAA |
| Auto-Shut Off | After 3 minutes of non-use and 2 minutes after reading |
| Dimensions | 87.5 x 63.7 x 35.2 mm (3.4 x 2.5 x 1.4") |
| Weight | 65 g (2.29 oz.) |

OPTIONAL ACCESSORIES

| | |
|-------------------|-------------------------------------|
| Reagent Sets | |
| MI528-25 | Iron powder reagent, 25 pcs. |
| Other Accessories | |
| 3000100 | Glass cuvettes with caps (2 pcs.) |
| 3000200 | Tissue fow wiping cuvettes (2 pcs.) |
| 3000300 | 1.5V AAA batteries (4 pcs.) |

CERTIFICATION

Milwaukee Instruments conform to the CE European Directives.

Disposal of Electrical & Electronic Equipment. Do not treat this product as household waste. Hand it over to the appropriate collection point for the recycling of electrical and electronic equipment.

Disposal of waste batteries. This product contains batteries. Do not dispose of them with other household waste. Hand them over to the appropriate collection point for recycling. Please note: proper product and battery disposal prevents potential negative consequences for human health and the environment. For detailed information, contact your local household waste disposal service or go to www.milwaukeeinstruments.com (USA & CAN) or www.milwaukeeinst.com.



RoHS compliant



RECOMMENDATION


Before using this product, make sure it is entirely suitable for your specific application and for the environment in which it is used. Any modification introduced by the user to the supplied equipment may compromise the tester's performance. For your and the tester's safety do not use or store the tester in hazardous environment. To avoid damage or burn, do not perform any measurement in microwave ovens.

WARRANTY

This instrument is warranted against defects in materials and manufacturing for a period of 2 years from the date of purchase. This warranty is limited to repair or free of charge replacement if the instrument cannot be repaired. Damage due to accidents, misuse, tampering or lack of prescribed maintenance is not covered by warranty. If service is required, contact your local Milwaukee Instruments Technical Service. If the repair is not covered by the warranty, you will be notified of the charges incurred. When shipping any instrument, make sure it is properly packaged for complete protection.

USER MANUAL

MW14 Digital Iron Tester

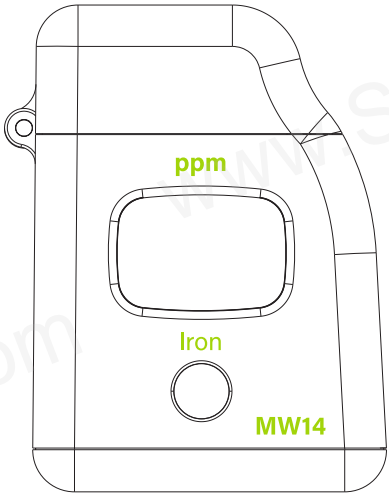

milwaukeeinstruments.com (USA & CAN)
milwaukeeinst.com




PRELIMINARY EXAMINATION

Please examine this product carefully. Make sure that the instrument is not damaged. If any damage occurred during shipment, please notify your Dealer.

Each **MW14** tester is supplied complete with:

- Two Sample Cuvettes and Caps
- Six powder reagents for Iron High Range
- 1 x 1.5V AAA Battery
- Instruction Manual

FUNCTIONAL DESCRIPTION

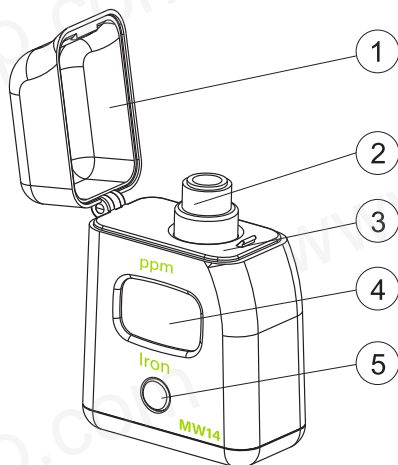

1. Dust cover
2. Cuvette with cap
3. Cuvette holder
4. Liquid Crystal Display
5. Button

OPERATION

- Turn the tester on by pressing the button. After all the segments are displayed, "C.1", "Add" appears with "Press" blinking, the tester is ready.




- Fill the cuvette with 10 mL of unreacted sample and replace the cap. Place the cuvette into the tester and close the tester's cap.



- Press the button. When the display shows "Add", "C.2" with "Press" blinking the tester is zeroed.



- Remove the cuvette, open it and add the content of one packet of **MI528-0** reagent. Replace the cap and shake gently for 2 minutes until the powder is completely dissolved. Replace the cuvette into the tester.

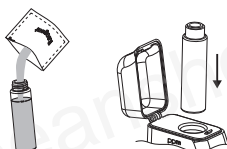

- Wait for 2 minutes and 30 seconds and then press the button or press and hold the button until the timer is displayed on the LCD.




- The instrument directly displays the concentration of iron in ppm. The tester automatically turns off after 2 minutes.



BATTERY REPLACEMENT

To save the battery, the instrument shuts down after 3 minutes of non-use and 2 minutes after reading. One fresh battery lasts for a minimum of 5000 measurements, depending on the light level. When the battery capacity is under 10 % "bAt" appears on the LCD at start-up.

If the battery is empty and accurate measurements can't be taken any more, the instrument shows "bAd" then "bAt" each for 1 second and turns off. To restart the instrument, the battery must be replaced with a fresh one.

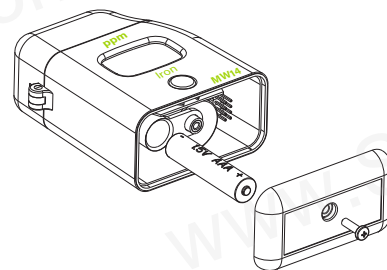

To replace the instrument's battery, follow the steps:

- Turn the instrument off by holding the button until the tester shuts off.
- Turn the instrument upside down and remove the battery cover with a screwdriver.
- Remove the battery from its location and replace it with a fresh one.
- Insert the battery cover and replace the screw with a screwdriver.